		DI8ZW-01
DTC	P0300	Random/Multiple Cylinder Misfire Detected
DTC	P0301	Cylinder 1 Misfire Detected
	•	
DTC	P0302	Cylinder 2 Misfire Detected
DTC	P0303	Cylinder 3 Misfire Detected
DTC	P0304	Cylinder 4 Misfire Detected
	•	
DTC	P0305	Cylinder 5 Misfire Detected

DTC	P0306	Cylinder 6 Misfire Detected
-----	-------	-----------------------------

CIRCUIT DESCRIPTION

Misfire: The ECM uses the crankshaft position sensor and camshaft position sensor to monitor changes in the crankshaft rotation of each cylinder.

The ECM counts the number of times of indicating that misfire has occurred by using the engine speed change rate. And when the misfire rate equals to or exceeds the count of indicating that the engine condition has deteriorated, the MIL lights up.


If the misfire rate is very high and the driving conditions cause the catalyst to overheat, the MIL shows an occurence of misfire by blinking.

DTC No.	DTC Detection Condition	Trouble Area
P0300	Misfiring of random cylinders is detected during any particular 200 or 1,000 revolutions	 Open or short in engine wire Connector connection Vacuum hose connection Ignition system Injector Fuel pressure Mass air flow meter Engine coolant temp. sensor Compression pressure Valve clearance Valve timing ECM
P0301 P0302 P0303 P0304 P0305 P0306	For any particular 200 revolutions for engine, misfiring is de- tected which can cause catalyst overheating (This causes MIL to blink) For any particular 1,000 revolutions of engine, misfiring is de- tected which causes a deterioration in emission (2 trip detection logic)	

HINT:

When the 2 or more codes for a misfiring cylinder are recorded repeatedly but no Random Misfire code is recorded, it indicates that the misfires were detected and recorded at different times.

WIRING DIAGRAM

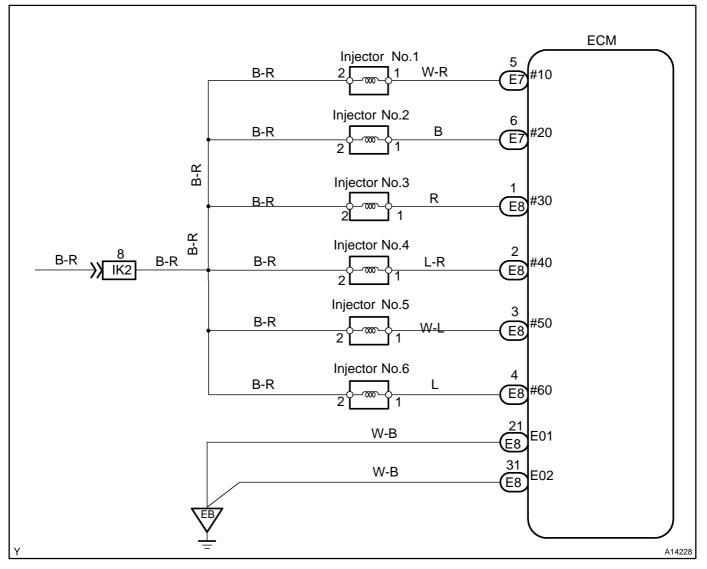

CONFIRMATION DRIVING PATTERN

- (a) Connect the TOYOTA hand-held tester or OBD II scan tool.
- (b) Record the DTC and freeze frame data.
- (c) Use the TOYOTA hand-held tester to set to the check mode (See page DI-146).
- (d) Drive the vehicle several times with the engine speed, load and its surrounding range shown with EN-GINE SPD, CALC LOAD in the freeze frame data or MISFIRE RPM, MISFIRE LOAD in the data list. Without TOYOTA hand-held tester, turn the ignition switch OFF after the symptom is simulated once. Then repeat the simulation process again.

HINT:

In order to memorize DTC of misfire, it is necessary to drive around MISFIRE RPM, MISFIRE LOAD in the following period of time in the data list.

Engine Speed	Time
Idling	3 minutes 30 seconds or more
1,000 rpm	3 minutes or more

2001 TOYOTA TACOMA (RM835U)

Author :

459

2,000 rpm	1 minute 30 seconds or more
3,000 rpm	1 minute or more

- (e) Check whether there is misfire or not by monitoring the DTC and freeze frame data, and then record them.
- (f) Turn the ignition switch OFF and wait at least 5 seconds.

INSPECTION PROCEDURE

HINT:

- In case that DTCs besides misfire are memorized simultaneously, first perform the troubleshooting for them.
- Read freeze frame data using TOYOTA hand-held tester or OBD II scan tool, as freeze frame records the engine conditions when a malfunction is detected. When troubleshooting, it is useful for determining whether the vehicle was running or stopped, the engine was warmed up or not, the air-fuel ratio was lean or rich, etc. at the time of the malfunction.
- If the misfine does not occur when the vehicle is brought to the workshop, misfire can be confirmed by reproducing the condition of the freeze frame data. Also, after finishing the repair, confirm that there is no misfire (See the confirmation driving pattern).
- When either of SHORT FT #1, LONG FT #1, SHORT FT #2 or LONG FT#2 in the freeze frame data is over the range of ±20 %, there is a possibility that the air-fuel ratio is inclining either to RICH (-20 % or less) or LEAN (+20 % or more).
- When COOLANT TEMP in the freeze frame data is less than 80°C (176°F), there is a possibility of misfire only during warmed up the engine.
- In case that the misfire cannot be reproduced, the reason may be because of driving with lack of fuel, a use of improper fuel, a stain of the ignition plug, and etc.

Check wire harness, connector and vacuum hose in engine room.

CHECK:

1

- (a) Check the connection conditions of wire harness and connector.
- (b) Check the disconnection, piping and break of vacuum hose.




Repair or replace, then confirm that there is no misfire (See confirmation driving pattern).

OK

2

Check spark plug and spark of misfiring cylinder.

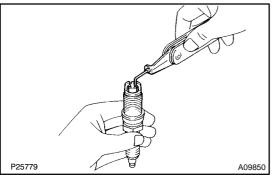

PREPARATION:

- (a) Remove the ignition coil and high tension cord.
- (b) Remove the spark plug.

CHECK:

- (a) Check the spark plug type.
- (b) Check the electrode for carbon deposits.
- (c) Check the electrode gap.

<u>OK:</u>

(a) Twin ground electrodes type.

Recommended spark plug:

DENSO made: K16TR11

NGK made: BKR5EKB-11

- (b) No large carbon deposit present.
- (c) Electrode gap: 1.1 mm (0.043 in.)

PREPARATION:

- (a) Install the spark plug to the ignition coil or high tension cord.
- (b) Disconnect the injector connector.
- (c) Ground the spark plug.

 
CHECK:

Check if spark occurs while the engine is being cranked. **NOTICE:**

To prevent excess fuel from being injected from the injectors during this test, don't crank the engine for more than 5 - 10 sec. at a time.

<u>OK:</u>


Spark is scattered on electrode gap.



ок

3

Check voltage of ECM terminal for injector of failed cylinder.

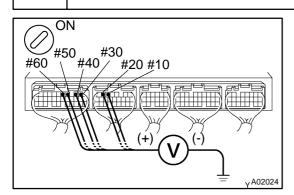

PREPARATION:


- (a) Remove the glove compartment (See page SF-54).
- (b) Turn the ignition switch ON.

CHECK:

Measure the voltage between applicable terminal of the ECM connector and the body ground.

<u> 0K:</u>

Voltage: 9 - 14 V

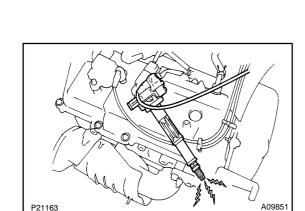

Reference: INSPECTION USING OSCILLOSCOPE

With the engine idling, check the waveform between terminals #10 - #60 and E01 of the ECM connector. HINT:

The correct waveform is as shown.

