DIB1W-01

DTC		Knock Sensor 1 Circuit (Bank 1 or Single Sensor)	
-----	--	--	--


DTC	P0330	Knock Sensor 2 Circuit (Bank 2)
-----	-------	---------------------------------

CIRCUIT DESCRIPTION

The knock sensors are fitted on the right bank and left bank of the cylinder block to detect the engine knocking. Each this sensor contains a piezoelectric element which generates a voltage when it becomes deformed, which occurs when the cylinder block vibrates due to the knocking. If the engine knocking occurs, the ignition timing is retarded to suppress it.

DTC No.	DTC Detection Condition	Trouble Area
P0325	No knock sensor 1 signal to ECM with engine speed between 1,700 rpm and 5,400 rpm	Open or short in knock sensor 1 circuit Knock sensor 1 (looseness) ECM
P0330	No knock sensor 2 signal to ECM with engine speed between 1,700 rpm and 5,400 rpm	Open or short in knock sensor 2 circuit Knock sensor 2 (looseness) ECM

WIRING DIAGRAM

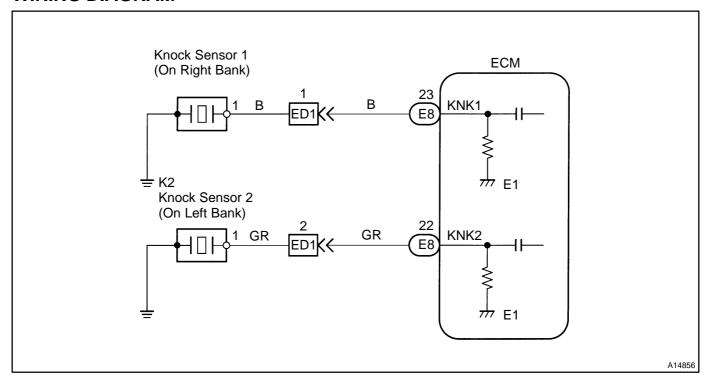

INSPECTION PROCEDURE


HINT:

- DTC P0325 is for the right bank knock sensor circuit.
- DTC P0330 is for the left bank knock sensor circuit.

2003 TOYOTA TACOMA (RM1002U)

Author: Date: 574

- Read freeze frame data using the hand-held tester or the OBD II scan tool, as freeze frame data records the engine conditions when a malfunction is detected. When troubleshooting, it is useful for determining whether the vehicle was running or stopped, the engine was warmed up or not, the air-fuel
 ratio was lean or rich, etc. at the time of the malfunction.
 - 1 Connect OBD II scan tool or hand-held tester, and check knock sensor circuit.

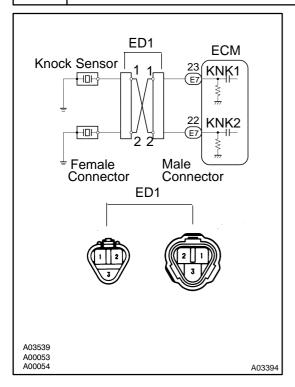

0.5 V KNK Signal Waveform 0 V 5 msec./Division 200 mV /Division 0 V 0.1 msec./Division A00113

PREPARATION:

- (a) Connect the OBD II scan tool or hand–held tester to the DLC3.
- (b) Disconnect the ED1 connector.
- (c) Connect the terminals of the disconnected ED1 male connector and ED1 female as follows.

Male connector – Female connector	
Terminal 1 – Terminal 2	
Terminal 2 – Terminal 1	

- (d) Turn the ignition switch ON and push the OBDII scan tool or hand–held tester main switch ON.
- (e) After the engine is warmed up, perform quick racing to 4,000 rpm 3 times.

CHECK:

Check the DTC.

RESULT:

Type I	DTC same as when vehicle brought in P0325 \rightarrow P0325 or P0330 \rightarrow P0330
Type II	DTC different to when vehicle brought in $P0325 \rightarrow P0330$ or $P0330 \rightarrow P0325$

Reference: INSPECTION USING OSCILLOSCOPE

 With the engine racing (4,000 rpm), Check the waveform between terminals KNK1, KNK2 of the ECM connector and body ground.

HINT:

The correct waveform is as shown.

 Spread the time on the horizontal axis, and confirm that period of the wave is 0.141 msec.

(Normal mode vibration frequency of knock sensor: 7.1 kHz)

HINT:

If normal mode vibration frequency is not 7.1 kHz, the sensor is malfunctions or ECM (terminal KNK1, 2).

2003 TOYOTA TACOMA (RM1002U)

Author: Date: 575

Type II

Go to step 3.

Type I

2 Check for open and short in harness and connector between ED1 connector and ECM (See page IN-28).

NG

Repair or replace harness or connector.

OK

Check and replace ECM (See page IN-28).

3 Check for open and short in harness and connector between ED1 connector and knock sensor (See page IN-28).

HINT:

- If DTC P0325 has changed to P0330 check the knock sensor circuit on the right bank side.
- If DTC P0330 has changed to P0325 check the knock sensor circuit on the left bank side.

NG

Repair or replace harness or connector.

OK

Replace knock sensor.